

D

C

В

Α

8


BURNDYWeld[™] TOOL KIT

B38030200 (ITEM NO. 1050408) TOOL KIT WITH TOOLS SHOWN EXCEPT RASP. B38030202 TOOL KIT WITH TOOLS SHOWN AND RASP. B38030300 TOOL BOX ONLY.




BURNDYWeldTM TOOLS

B38030900 (ITEM NO. 10051414) FLINT IGNITOR.
B38030400 (ITEM NO. 10050409) 8" FILE.
B38030700 (ITEM NO. 10050412) CRIMPING TOOL.
B38392200 (ITEM NO. 10050430) MOLD CLEANING BRUSH.
B38030800 (ITEM NO. 10050413) 6" SCREWDRIVER.
B38030500 (ITEM NO. 10050410) WIRE BRUSH.
B38010100 (ITEM NO. 10050403) RASP.
B38030600 (ITEM NO. 10050411) CARD CLOTH BRUSH.

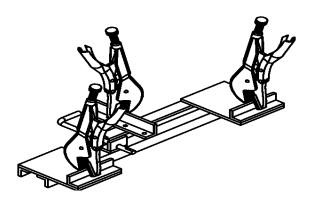

B38033000 CABLE CLAMP (ITEM NO. 10050420)

THE BURNDYWeId CABLE CLAMP IS RECOMMENDED FOR HOLDING A WIDE RANGE OF CABLES PROPERLY IN PLACE IN MOLDS WHEN WELDING CABLES THAT ARE UNDER TENSION THIS PREVENTS THE CABLES FROM PULLING OUT OF THE MOLD WHEN THE WELD IS MADE.

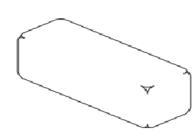

D

PACKING MATERIAL
PACKING MATERIAL
(PUTTY CLAY) IS USED TO PREVENT THE
MOLTEN WELD METAL FROM LEAKING OUT OF THE MOLD. WHEN
THE CABLE OPENING BECOMES WORN FROM HEAVY USE, THE
PACKING MATERIAL MAY BE USED TO PROLONG MOLD USE. IT
IS ALSO USED AROUND 7 STRAND CABLE TO PREVENT LEAKING.
PACKING MATERIAL COMES IN A I LB. OR 5 LB. PACKAGE.

CATALOG NO.	DESCRIPTION	ITEM NO.
B38412900	I LB. PACKAGE	10050437
B38412905	5 LB. PACKAGE	10050438



B38010100 RASP (ITEM NO. 10050403)

THIS TEMPERED STEEL, CURVED RASP IS RECOMMENDED FOR REMOVING RUST AND MILL SCALE FROM STEEL AND CAST IRON SURFACES. THE BLADE IS REPLACEABLE, TO ORDER REPLACEMENT RASP BLADE SPECIFY CATALOG NUMBER 38010100 (ITEM NO. 10050403) NOT RECOMMENDED FOR USE ON GALVANIZED SURFACES.



38030900 FLINT IGNITOR (ITEM NO. 10051414)

THE B38030900 (ITEM NO. 10051414) FLINT IGNITOR IS USED TO IGNITE THE STARTING POWER. EACH MOLD THAT IS SOLD WITH A FRAME HAS A FLINT IGNITOR INCLUDED.



THE CABLE CLEANING BRUSH IS RECOMMENDED FOR CLEANING HEAVILY OXIDIZED CABLES. THE V-SHAPE BRUSHES PERMIT THEIR USE OVER A WIDE RANGE OF CABLE SIZES. BRUSH ASSEMBLY CONSISTS OF A HANDLE WITH TWO STIFF WIRE BRISTLE BRUSHES THAT ARE ROTATABLE, FOR LONGER LIFE AND ARE REPLACEABLE.

THE CARD CLOTH BRUSH IS USED FOR CLEANING LARGE CONDUCTORS AND BUS BAR. IT HAS SHORT STIFF BRISTLES. THESE BRUSHES ARE FOR CLEANING CABLE ONLY. NOT MOLDS.

THE MOLD CLEANING BRUSH IS USED TO CLEAN THE GRAPHITE MOLD WITHOUT SCRATCHING THE MOLD.

CABLE CLEANING BRUSH B38013500 (ITEM NO. 10050406)
REPLACEMENT BRUSH B38013501 (ITEM NO. 10050407)
CARD CLOTH BRUSH B38030600 (ITEM NO. 10050411)
MOLD CLEANING BRUSH B38392200 (ITEM NO. 10050430)



MOLD CLEANERS ARE USED TO CLEAN THE SLAG FROM MOLDS THAT ARE NOT SPLIT THROUGH THE CRUCIBLE.
B40031901 (ITEM NO. 10050455) FOR CARTRIDGE SIZES #15 THRU #65
B40031903 (ITEM NO. 10050456) FOR CARTRIDGE SIZES #90 THRU #500

GROUND ROD DRIVING SLEEVES ARE PLACED OVER THE TOP OF A GROUND ROD WHILE DRIVING IT INTO THE GROUND. THIS PREVENTS THE TOP FROM MUSHROOMING OR FLARING OUT. GROUND ROD DRIVING SLEEVES ARE AVAILABLE IN SIZES TO FIT ALL STANDARD UNTHREADED GROUND RODS.

CATALOG NUMBER	BURNDY ITEM NUMBER	FOR USE ON
B38366201	10050423	1/2" COPPER CLAD OR STEEL GROUND ROD
B38366202	10050424	5/8" COPPER CLAD GROUND ROD
B38366205	10050427	5/8" STEEL GROUND ROD
B38366203	10050425	3/4" COPPER CLAD GROUND ROD
B38366206	10050428	3/4" STEEL GROUND ROD
B38366204	10050426	I" COPPER CLAD GROUND ROD
B38366507	10050429	I" STEEL GROUND ROD



TO ORDER BURNDY® PRODUCTS CALL

UNITED STATES
1-800-346-4175 (LONDONDERRY, NH)

CANADA: 1-800-361-6975 (QUEBEC) 1-800-387-6487 (ALL OTHER PROVINCES) FOR PRODUCT INFO: http://www.burndy.com

	BURNDYWeld TM ACCESSORIES						
	ITEM NO:	SEE TABLE	E				
	CAT. NO:	SEE TABLE	E				
	DRAWN BY:	P,LAPONIUS	12/8/04				
	CHECKER:	D, SHIBILIA	1/3/05				
	DSN APPVL:	D.SHIBILIA	1/13/05	6 BURN			
	MFG APPVL:						
	QA APPVL:	J.BRODEUR	1/14/05				
	MKT APPVL:	R.ROBICHEAU 1/18/05		SCALE:	N/A		
	PROD FAM:			DRAWING NO	REV		
n	PROJECT #:		SIZE	10051616	_		
" [Sales	D	10031616	l B I		
	REL LEVEL:	Released	U	SHEET I OF I			

7 6 5 4 3 2